

Operation instruction • english
Gebrauchsanweisung • deutsch
Gebruiksaanwijzing • nederlands
Manuel d'utilisation • français

19101811E

0751

KEMPACT

PULSE 3000

KEMPACTCOOL

10




CONTENTS

1. PREFACE	3
1.1. INTRODUCTION.....	3
1.2. PRODUCT INTRODUCTION.....	3
1.3. SAFETY INSTRUCTIONS.....	3
2. BEFORE YOU START USING THE UNIT	6
2.1. UNPACKING	6
2.2. PLACEMENT OF THE UNIT	6
2.3. SERIAL NUMBER	6
2.4. CONNECTION TO THE MAINS SUPPLY	6
2.5. GROUND CABLE.....	6
2.6. INSTALLATION OF WELDING GUN.....	8
2.7. MOUNTING AND LOCKING OF WIRE REEL.....	8
2.8. AUTOMATIC WIRE FEED TO GUN	8
2.9. ADJUSTMENT OF PRESSURE.....	8
2.10. ADJUSTMENT OF TIGHTNESS OF SPOOL BRAKE.....	9
2.11. SHIELDING GAS.....	9
2.12. COOLING UNIT (KEMPACTCOOL 10).....	10
3. OPERATION	11
3.1. MAIN SWITCH AND SIGNAL LIGHTS.....	11
3.2. TO SELECT POLARITY FOR WELDING.....	11
3.2.1. CHANGING THE POLARITY.....	11
3.3. PANEL	12
3.3.1. CHOOSING START SWITCH FUNCTION	12
3.3.2. CHOOSING THE WELDING METHOD	12
3.3.3. SELECTING 1-MIG/PULSE MIG SYNERGY CURVES.....	13
3.3.4. ADJUSTMENTS, DISPLAY AND WELD DATA	15
3.3.5. TIMER	15
3.3.6. ADJUSTMENT OF WELDING DYNAMICS.....	15
3.3.7. REMOTE CONTROL	15
3.3.8. MIG EXTRA FUNCTIONS.....	15
3.3.9. USE OF GAS TEST	16
3.3.10. TESTING WIRE FEED.....	16
3.3.11. MEMORY CHANNELS, MEMORY.....	17
3.3.12. SETUP	17
3.3.13. ERROR CODES	19
3.4. COOLING UNIT OPERATION (KEMPACTCOOL 10).....	19
4. MAINTENANCE	20
4.1. DAILY MAINTENANCE	20
4.2. REGULAR MAINTENANCE	20
4.3. DISPOSAL OF THE MACHINE.....	20
5. ORDERING INFORMATION	20
6. TECHNICAL DATA	22
7. TERMS OF GUARANTEE	23

1. PREFACE

1.1. INTRODUCTION

Congratulations on having purchased a KEMPPI product. Properly installed and used KEMPPI products should prove to be productive machines requiring only a small amount of regular maintenance. This manual is designed to give you a good understanding of the equipment and its safe use. There is also information on maintenance of the unit and the machine's technical data. Read the instructions before bringing the machine into use or servicing it for the first time. Additional information on Kemppi products and their use can be obtained from Kemppi or a Kemppi dealer. The specifications and designs presented in this manual are subject to change without prior notice. In this document, the following symbol is used to indicate a risk of injury or death: 

Read the warnings carefully and follow the instructions. Please also study the instructions for safe operation and follow them when installing, operating and servicing the machine.

1.2. PRODUCT INTRODUCTION

The Kempact Pulse 3000 is a compact MIG inverter suitable for repair and installation use, and for light and medium industrial use.

1.3. SAFETY INSTRUCTIONS

Kemppi welding devices conform to international safety standards. Safety is an important issue in equipment design and manufacturing. Therefore, Kemppi welding solutions are unparalleled in safety. There are, however, always certain hazards involved in using welding equipment. Therefore, to ensure your personal safety and the safety of your working environment, carefully read the safety instructions below and respect them.

Use of personal protective equipment

- The arc and its reflecting radiation damage unprotected eyes. Shield your eyes and face appropriately before you start welding or observe welding. Also note the different requirements for the darkness of the screen in the mask as the welding current changes.
- The arc radiation and spatters burn unprotected skin. Always wear protective gloves, clothing and footwear when welding.
- Always wear hearing protection if the ambient noise level exceeds the allowable limit (e.g., 85 dB(A)).

General operating safety

- Exercise caution when handling parts heated in welding. For example, the tip of the welding torch, the end of the welding rod and the work piece will heat during gouging to a burning temperature.
- Never wear the device on the shoulder during welding and never suspend it by the carrying strap during welding.
- Do not expose the machine to high temperatures, as heat may cause damage to the machine.
- Keep the torch cable and earthing cable as close to each other as possible throughout their length. Straighten any loops in the cables. This minimises your exposure to harmful magnetic fields, which may interfere with a pacemaker, for example.
- Do not wrap the cables around the body.
- In environments classified as dangerous, only use S-marked welding devices with a safe idle voltage level. These work environments include, for example, humid, hot or small spaces where the user may be directly exposed to the surrounding conductive pieces.

Spatter and fire safety

- Welding is always classified as hot work, so pay attention to fire safety regulations during welding and after it.
- Remember that fire can break out from sparks even several hours after the welding work is completed.
- Protect the environment from welding splatter. Remove flammable materials, such as flammable fluids, from the welding vicinity and supply the welding site with adequate fire fighting equipment.
- In special welding jobs, be prepared for hazards such as fire or explosion when welding container type work pieces.
- Never direct the spark spray or cutting spray of a grinder toward the welding machine or flammable materials.
- Beware of hot objects or splatter falling on the machine when working above the machine.
- Welding in flammable or explosive sites is absolutely forbidden.

General electric safety

- Only connect the welding machine to an earthed electric network.
- Note the recommended mains fuse size.
- Do not take the welding machine inside a container, vehicle or similar work piece.
- Do not place the welding machine on a wet surface and do not work on a wet surface.
- Do not allow the mains cable to be directly exposed to water.
- Ensure cables or welding torches are not squashed by heavy objects and that they are not exposed to sharp edges or a hot work piece.
- Make sure that faulty and damaged welding torches are changed immediately as they can be lethal and may cause electrocution or fire.
- Remember that the cable, plugs and other electric devices may be installed or replaced only by an electrical contractor or engineer authorised to perform such operations.
- Turn off the welding machine when it is not in use.

Welding power circuit

- Insulate yourself from the welding circuit by using dry and undamaged protective clothing.
- Never touch the work piece and welding rod, welding wire, welding electrode or contact tip at the same time.
- Do not put the welding torch or ground cable on the welding machine or other electric equipment.

Welding fumes

- Ensure proper ventilation and avoid inhaling the fumes.
- Ensure sufficient supply of fresh air, particularly in closed spaces. You can also ensure the supply of clean and sufficient breathing air by using a fresh-air mask.
- Take extra precautions when working on metals or surface-treated materials containing lead, cadmium, zinc, mercury or beryllium.

Transportation, lifting and suspension

- Never pull or lift the machine by the welding torch or other cables. Always use the lift points or handles designed for that purpose.
- Only use a transportation platform designed for the equipment.
- Try to transport the machine in an upright position, if possible.
- Never lift a gas cylinder and the welding machine at the same time. There are separate provisions for gas cylinder transportation.
- Never use a welding machine when suspended unless the suspension device has been designed and approved for that particular purpose.
- Do not exceed the maximum allowed load of suspension booms or the transportation trolley of welding equipment.
- It is recommended that the wire coil be removed during lifting or transportation.

Environment

- Protect welding machines from heavy rain and direct sunshine even if it were suitable for outdoor use.
- Always store the machine in a dry and clean space.
- Protect the machine from sand and dust during use and in storage.
- The recommended operating temperature range is -20 to +40 °C. The machine's operation efficiency decreases and it becomes more prone to damage if used in temperatures in excess of 40 °C.
- Place the machine so that it is not exposed to hot surfaces, sparks or spatter.
- Make sure the airflow to and from the machine is unrestricted.
- This electromagnetic compatibility (EMC) of professional equipment is usually designed for industrial use. Such class-A equipment is not intended for use in residential locations where the electrical power is provided by the public low-voltage supply system. The machine may interfere with sensitive home electronic devices.

Gas bottles and pneumatic devices

- Adhere to the instructions for handling pneumatic devices and gas bottles.
- Make sure that gas bottles are used and stored in properly ventilated spaces. A leaking gas bottle may replace the oxygen in the inhaled air, causing suffocation.
- Before use, make sure that the gas bottle contains gas suitable for the intended purpose.
- Always fix the gas cylinder securely in an upright position, against a cylinder wall rack or purpose-made cylinder cart.
- Never move a protective gas bottle when the flow adjuster is in place. Put the valve cover in place during transportation.
- Always close the gas cylinder valve after use.

2. BEFORE YOU START USING THE UNIT

2.1. UNPACKING

The equipment is packed in durable packages, designed specially for it. Nevertheless, before using the equipment, always make sure it was not damaged during transport. Also check that you have received what you ordered and it is accompanied by the appropriate instructions. NOTE! The packaging material is suitable for recycling.

2.2. PLACEMENT OF THE UNIT

Place the unit on a horizontal, solid, and clean surface. Shield it from heavy rain and scorching sun. Make sure that cooling air circulates freely.

2.3. SERIAL NUMBER

The serial number of the unit is marked on its rating plate. The serial number makes it possible to trace product manufacturing series. You might need the serial number when placing spare parts orders or when planning maintenance.

2.4. CONNECTION TO THE MAINS SUPPLY

The Kempact Pulse 3000 is delivered with a five metre mains cable without a plug. Installation of the plug should be carried out only by a competent electrician. For fuse and cable sizes, see the technical data in the end of this document.

2.5. GROUND CABLE

Fasten the earth clamp of the return current cable carefully, preferably direct onto the piece to be welded. The contact surface of the earth clamp should always be as large as possible.

Clean the fastening surface of paint and rust. Use at least two 35 mm² cables. Thinner cross sectional areas may cause the connectors to overheat.

DuraTorque™ 400

 
4 - roll wire feed mechanism




Wire guide tubes

Ss, Al Fe, Mc Fc	ø 0,6...1,6 mm	→	ø 2,5/64 mm W000762 silver, plastic	→	ø 2,5/33 mm W000956 silver, plastic	→	ø 2,0 mm W000624 plastic
	ø 1,6...2,4 mm	→	ø 3,5/64 mm W001430 silver, plastic	→	ø 3,5/33 mm W001431 silver, plastic	→	ø 3,5 mm W001389 plastic
Fe Mc Fc	ø 0,6...0,8 mm	→	ø 1,0/67 mm W001432 white, steel	→	ø 2,0/33 mm W001435 orange, steel	→	ø 2,0 mm W000624 plastic
	ø 0,9...1,6 mm	→	ø 2,0/64 mm W001433 orange, steel	→	ø 3,5/33 mm W001436 orange, steel	→	ø 3,5 mm W001389 plastic
	ø 1,6...2,4 mm	→	ø 4,0/63 mm W001434 blue, steel	→	ø 4,0/33 mm W001436 blue, steel	→	ø 3,5 mm W001391 brass

Feed rolls



Fe Ss Al	Plain	0,6	1	W001045	pale grey
		0,6	2	W001046	pale grey
		0,8/0,9	1	W001047	white
		0,8/0,9	2	W001048	white
		1,0	1	W000675	red
		1,0	2	W000676	red
		1,2	1	W000960	orange
		1,2	2	W000961	orange
		1,4	1	W001049	braun
		1,4	2	W001050	braun
		1,6	1	W001051	yellow
		1,6	2	W001052	yellow
		2,0	1	W001053	grey
2,0	2	W001054	grey		
2,4	1	W001055	black		
2,4	2	W001056	black		
Fe Fc Mc	Knurled	1,0	1	W001057	red
		1,0	2	W001058	red
		1,2	1	W001059	orange
		1,2	2	W001060	orange
		1,4/1,6	1	W001061	yellow
		1,4/1,6	2	W001062	yellow
		2,0	1	W001063	grey
		2,0	2	W001064	grey
		2,4	1	W001065	black
		2,4	2	W001066	black
		Fe Fc Mc Ss Al	U-groove	1,0	1
1,0	2			W001068	red
1,2	1			W001069	orange
1,2	2			W001070	orange
1,6	1			W001071	yellow
1,6	2			W001072	yellow

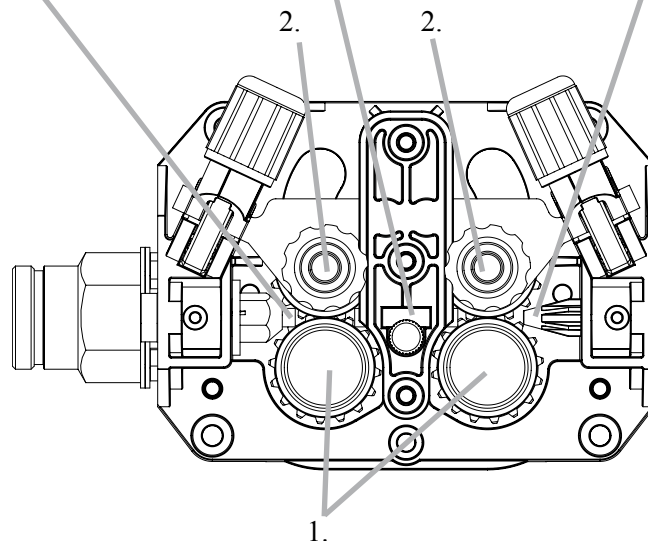

1 = drawing feed roll, 2 = pressing feed roll


2.6. INSTALLATION OF WELDING GUN

Make sure the gun wire conduit and the contact tip match the manufacturer's recommendations for the type and diameter of wire you use. Too small a conduit may overload the wire feed device and impede the wire feeding. Tighten the gun's quick connector to eliminate voltage loss. A loose joint will heat up the gun and wire heater.




Never use defected gun.

2.7. MOUNTING AND LOCKING OF WIRE REEL

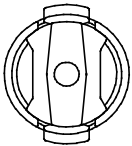

LOCKED

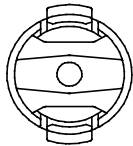

OPEN

- Release locking nails of wire reel hub by turning locking knob a quarter round.
- Mount the reel at its place. Note rotating direction of reel!
- Lock the reel with locking knob, locking nails of hub remain to outside position and will lock the reel.

2.8. AUTOMATIC WIRE FEED TO GUN

Automatic wire feed makes change of wire reel more rapid. In reel change the pressure of feed rolls need not to be released and filler wire goes automatically to correct wire line.

- Make sure that groove of feed roll matches the diameter of welding wire used.
- Release the wire end from reel and cut off the bent length. Be careful that the wire does not spill from the reel to sides!
- Straighten about 20 cm of the wire and see that the end of it has no sharp edges (file off if necessary). A sharp edge may damage the wire guide tube and contact tip of the welding gun.
- Draw a bit of loose wire from wire reel. Feed wire through back liner to feed rolls. Do not release pressure of feed rolls!
- Press the gun switch and feed a bit wire until wire goes through feed rolls to gun. See that wire is in grooves of both feed roll pairs!
- Press still the gun switch until wire has come through contact tip.

Automatic feed may sometimes fail with thin wires (Fe, Fc, Ss: 0,6...0,8 mm, Al: 0,8...1,0 mm). In that case you might have to open feed rolls and feed wire manually through feed rolls.



Note! Check that the wire or wire reel does not touch the equipment body, there is a danger of short circuit

2.9. ADJUSTMENT OF PRESSURE


Adjust the pressure of the feed rolls with the control screw so that the wire is fed into the wire guide tube evenly and allows a little braking when emerging from the contact tip, without slipping on the feed rolls.



Excessive pressure will cause the filler wire to flatten and damage its coating, as well as undue wear and tear of the feed rolls and friction damage.

2.10. ADJUSTMENT OF TIGHTNESS OF SPOOL BRAKE


Brake force can be adjusted through the hole in the spool hub's locking device of spool hub by screwing the control screw with a screwdriver. Adjust the braking force so that it is sufficient to prevent the wire from becoming too loose on the spool and spilling when the spool stops rotating. The greater the wire feed speed, the greater the braking force required. Do not keep the brake unnecessarily tight, since this will impose a strain on the motor.

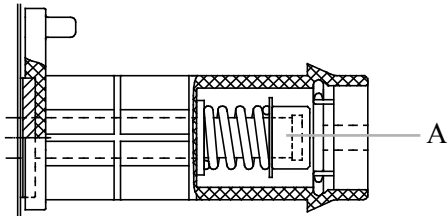

2.11. SHIELDING GAS

The MIG shielding gas consists of carbon dioxide, mixed gases and argon. Shielding gas flow rate is determined by the amount of welding current. The typical flow rate of gas in the welding steel is 8-15 l/min.

- A Gas bottle valve
- B Press regulation screw
- C Connecting nut
- D Hose spindle
- E Jacket nut
- F Gas bottle pressure meter
- G Gas hose pressure meter

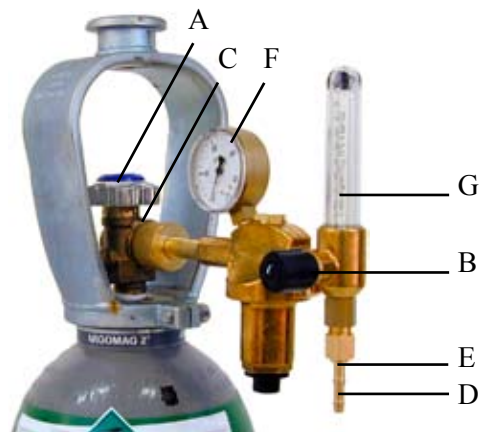

The following installation instructions are valid for most gas flow regulator types:

1. Step aside and open the bottle valve (A) for a while to blow out possible impurities.
2. Turn the press regulation screw (B) of the regulator until no spring pressure can be felt.
3. Close the needle valve if there is one in the regulator.
4. Install the regulator onto bottle valve and tighten the connecting nut (C) with a wrench.
5. Install the hose spindle (D) and jacket nut (E) into the gas hose and tighten with a hose clamp
6. Connect the hose with the regulator and the other end with the wire feed unit.
Tighten jacket nut.
7. Open the bottle valve slowly. The gas bottle pressure meter (F) shows bottle pressure.
Note! Do not use the whole contents of the bottle. The bottle pressure should be filled when bottle pressure is 2 bar.
8. Open the needle valve if there is one in the regulator.
9. Turn the regulation screw (B) until the hose pressure meter (G) displays the required flow (or pressure). When regulating the flow amount, the power source should be switched on and the "GAS PURGE" -switch pressed simultaneously.

Close the bottle valve after welding is finished. If the machine will not be in use for a long time, unscrew the pressure regulation screw.



Always fasten the gas cylinder securely in an upright position on a wall rack intended for the purpose or on a cylinder cart. Always close the cylinder valve after you have finished welding.

2.12. COOLING UNIT (KEMPACTCOOL 10)




Cooling liquid is injurious! Avoid also contact with skin or eyes. In case of injury, seek for medical advice.

Cooling unit KempactCool 10 together with MIG-gun of Kemppi's PMT-W and MMT-W range enables MIG welding with water-cooled gun.

The cooling unit is installed beneath the power source with screws and mounting plate. Electrical connections are on the bottom of power source. Fill the reservoir with a 20 - 40 % mixture of etanol and water, or with any other suitable antifreeze. The capacity of the reservoir is 3 litres.


Electrical connection for the cooling unit:

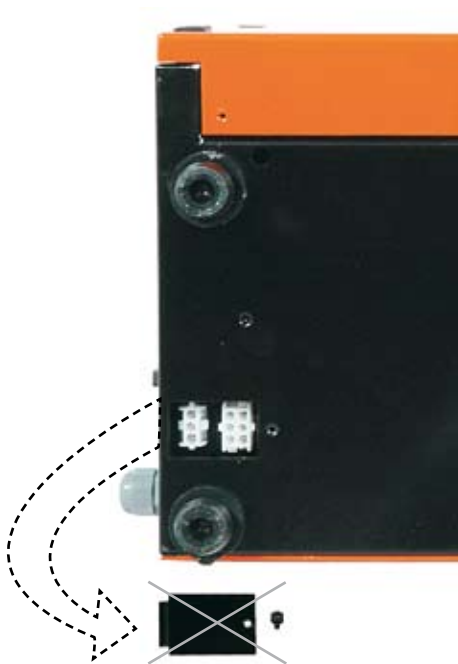

The bottom of power source


1. 230 V
2. Control connector
3. Equipment earth

Installation of cooling unit:

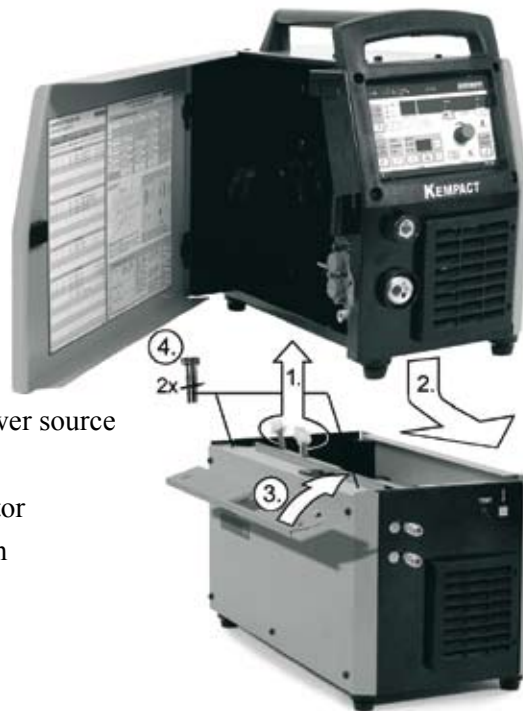

Only an authorised electrician is allowed to install electrical connection!

Filling the reservoir:

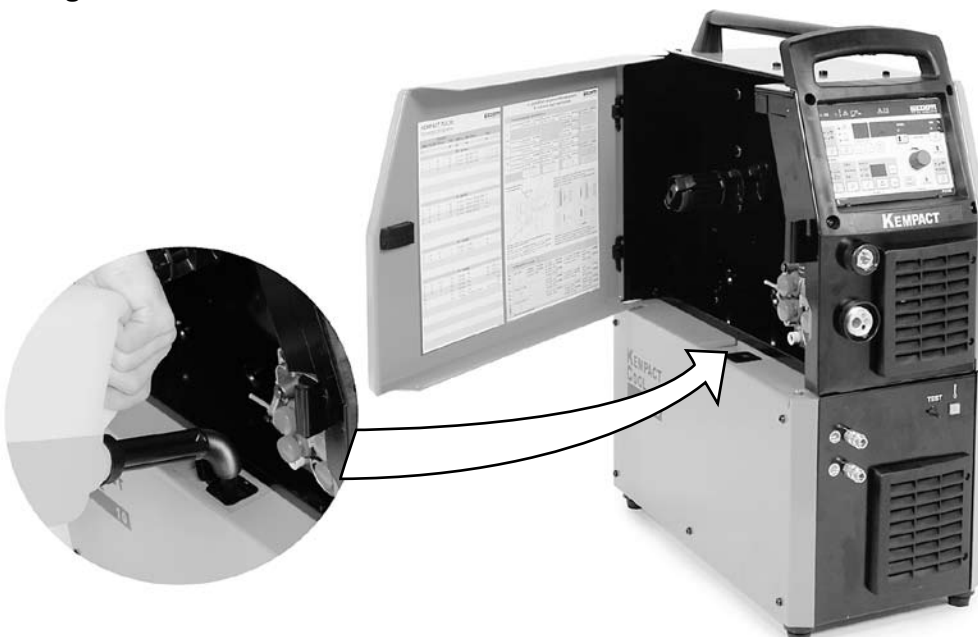

3. OPERATION

3.1. MAIN SWITCH AND SIGNAL LIGHTS

With the switch in the 'I' position, the primary and control circuits of the machine become live and the 'ON' signal light on the panel lights up. The welding circuit receives voltage when the gun switch is operated or when the wire feed test switch is pressed. Always use the main switch to turn the machine on and off with the main switch; do not use the power plug for this purpose.

3.2. TO SELECT POLARITY FOR WELDING


Solid wire is usually welded in the +pole and gasfree filler wires in the - pole gun. When welding with other filler wires, check for the recommended polarity on the package or consult the supplier of the product. The welding of very thin steelplates (0.5 to 0.7 mm) a - polarity might also work best for solid wire.

3.2.1. Changing the polarity



Only a service shop authorised by Kemppi may change the polarity.

3.3. PANEL

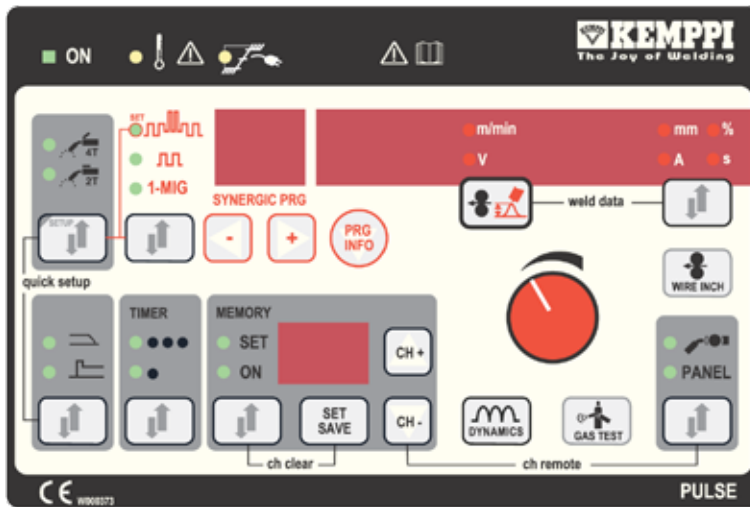

3.3.1. Choosing start switch function



MIG welding by 4-function start switch, MIG 4T
MIG welding by 2 function start switch, MIG 2T

3.3.2. Choosing the welding method



Normal MIG/MAG welding:

with a separate wire feed and voltage regulation can be chosen in the 1-MIG position. Curve number “00” provides a free wire feed range between 1-18 m/min. The voltage can be set between special pre-programmed limits depending on the wire feed. Curve number “01” wire feed speed and voltage are not depended on each other. When curve “01” is selected, the wire feed speed and voltage will be independent of one another.

Synergic MIG/MAG welding (1-MIG)

Synergic MIG/MAG welding (1-MIG): MIG welding in which the wire feed speed determines all the other welding parameter values, allowing the adjustment of welding power with a single knob. Choose the appropriate synergy curve for the filler wire and shielding gas to determine how the wire feed speed affects the pulse parameters.

Synergic Pulse MIG welding:

through this welding method, based on pulsing the welding current, the filler metal on the workpiece is kept spatter-free. The power source pulse parameters change automatically (synergy) enabling welding power regulation using a single knob. Choose the appropriate synergy curve for the filler wire and shielding gas to determine how the wire feed speed affects the pulse parameters.

Double pulse:

the wire feed will become higher or lower according to the wire feed range. While the synergic welding parameters change to correspond to the momentary wire speed. The purpose is to get a goodlooking weld and a proper penetration while improving the controllability of the weld pool during position welding.

3.3.3. Selecting 1-mig/pulse mig synergy curves



The program number of the synergy curve is selected using the plus-minus buttons and is displayed on "SYNERGIC PRG".

The middle display is actual material group display (eg. SS, AL, CUS, FE, GEN). Wire diameter (mm) can be seen on the right side. This information will only be displayed for a while.


The "PRG INFO" button gives more curve information:

One press will revert to the material group and diameter display, a second will display the type number of the material and a third run through the gas consistency components one by one.

KEMPACT PULSE 3000 Synergic programs						
1-MIG	Pulse	Double Pulse	Wire, ø	Material	Gas	Wire Feed Range
00			All	All	All	1,0 - 18,0
01			All	All	All	0,5 - 18,0
SS-group						
S1	S1	S1	0,8 mm	SS 308 / 316	Ar + 2 % CO ₂	
S2	S2	S2	0,9 mm	SS 308 / 316	Ar + 2 % CO ₂	
S3	S3	S3	1,0 mm	SS 308 / 316	Ar + 2 % CO ₂	
S4	S4	S4	1,2 mm	SS 308 / 316	Ar + 2 % CO ₂	
S5			0,9 mm	SS 316 FC	Ar + 18 % CO ₂	
S7			1,2 mm	SS 316 FC	Ar + 18 % CO ₂	
Al-group						
A1	A1	A1	1,0 mm	AlMg5 / AlMg4,5Mn	Ar	
A2	A2	A2	1,2 mm	AlMg5 / AlMg4,5Mn	Ar	
A6	A6	A6	1,0 mm	AlSi5 / AlSi12	Ar	
A7	A7	A7	1,2 mm	AlSi5 / AlSi12	Ar	
Cu-group						
C1	C1	C1	0,8 mm	CuSi3	Ar	
C2	C2	C2	0,9 mm	CuSi3	Ar	
C3	C3	C3	1,0 mm	CuSi3	Ar	
C4	C4	C4	1,2 mm	CuSi3	Ar	
C5	C5	C5	0,8 mm	CuAl8	Ar	
C6	C6	C6	0,9 mm	CuAl8	Ar	
C7	C7	C7	1,0 mm	CuAl8	Ar	
C8	C8	C8	1,2 mm	CuAl8	Ar	
Fe-group						
F1	F1	F1	0,8 mm	Fe	Ar + 18 % CO ₂	
F2	F2	F2	0,9 mm	Fe	Ar + 18 % CO ₂	
F3	F3	F3	1,0 mm	Fe	Ar + 18 % CO ₂	
F4	F4	F4	1,2 mm	Fe	Ar + 18 % CO ₂	

1-MIG	Pulse	Double Pulse	Wire, ø	Material	Gas	Wire Feed Range
F5			0,8 mm	Fe	CO ₂	
F6			0,9 mm	Fe	CO ₂	
F7			1,0 mm	Fe	CO ₂	
F8			1,2 mm	Fe	CO ₂	
FA	FA	FA	1,0 mm	FeMC	Ar + 18 % CO ₂	
FB	FB	FB	1,2 mm	FeMC	Ar + 18 % CO ₂	
FD			1,2 mm	FeFC	Ar + 18 % CO ₂	
Auto						
	20	20	1,0 mm	CuSi3-A	Ar	1,1 – 2,0
1	21	21	1,0 mm	CuSi3-A	Ar	2,0 – 2,6
2	22	22	1,0 mm	CuSi3-A	Ar	2,4 – 3,1
3	23	23	1,0 mm	CuSi3-A	Ar	3,0 – 3,6
4	24	24	1,0 mm	CuSi3-A	Ar	3,5 – 4,1
5	25	25	1,0 mm	CuSi3-A	Ar	4,0 – 4,6
6	26	26	1,0 mm	CuSi3-A	Ar	4,5 – 5,1
7	27	27	1,0 mm	CuSi3-A	Ar	5,0 – 5,5
8	28	28	1,0 mm	CuSi3-A	Ar	5,5 – 6,0
9	29	29	1,0 mm	CuSi3-A	Ar	6,0 – 6,5
10	30	30	1,0 mm	CuSi3-A	Ar	6,4 – 7,0
11	31	31	1,0 mm	CuSi3-A	Ar	6,9 – 7,6
12	32	32	1,0 mm	CuSi3-A	Ar	7,4 – 8,1

3.3.4. Adjustments, display and weld data

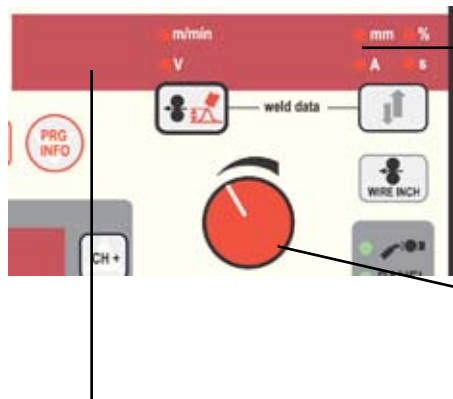

Display for welding current and welding material thickness. Changing can be made using the button behind the display. There is a percentage display (eg. gas consistency) and seconds display (see timer). The relative length of arc will be displayed when adjusted. Otherwise the predicted current value is displayed (not in 2-MIG).

Process Manager™ for setting all welding parameters.

The display for wire feed speed, welding voltage or material group. This can be switched using the button under the display (wire feed speed/length of arc). The voltage can be adjusted in the normal and 1-MIG position (wire feed range/the length of arc). During pulse welding the voltage is determined by the wire feed speed while the length of arc affects some other parameters.

When pressed simultaneously, the weld data buttons recall the wire feed speed on the display, the welding voltage and welding current values which have been used when welding was stopped.

3.3.5. Timer



intermittent welding

spot welding

The spot time is set immediately after pressing the switch button, on the display SPt. The pause time is set accordingly, on the PSE display. The time is set using the Process Manager.

3.3.6. Adjustment of welding dynamics



For adjusting of MIG/MAG welding dynamics, the adjustment value dyn -9...0...9 is displayed. The welding stability and quantity of spatter are affected by the welding dynamics control, the 0-position is the recommended reference range. Values -9...-1 give a smoother arc and less spatter, while values 1...9 give a rougher arc and increased stability, when using a 100% CO₂ shielding gas when welding steel.

3.3.7. Remote control




Gun control, wire feed speed or welding power control is changed using RMT 10. Control of the welding voltage or the length of the welding arc can be adjusted using the potentiometer on the panel. Panel control, adjustments using the potentiometer on the panel.

3.3.8. Mig extra functions



Crater filling, 1-MIG and pulse MIG:

Crater filling reduces welding mistakes caused by end craters. By pressing the 4T-trigger continuously at the end of weld, a descending welding power is achieved which fills end craters in a controlled manner. The descending time is kept constant using the 2T function, and the welding power and end level can be changed using the SETUP-function.

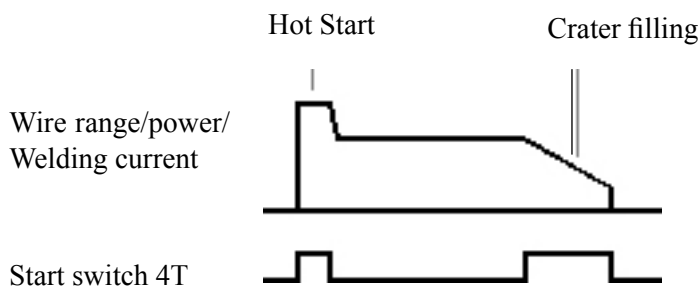

The Hot Start:

The Hot Start function is used with 1-MIG and pulse MIG welding. The Hot Start time by 4T Hot Start time is determined by trigger function (see picture) and while by 2T function it is determined by the SETUP parameters. The level of Hot Start can be changed by SETUP function.

The Hot Start level, Hot Start time by 2T, crater fill level and downslope time can be easily adjusted using the 'QUICK SETUP' function:

1. Select the gun trigger function: 4T or 2T.
2. First, press the SETUP button and then , while still pressing the SETUP button, press the extra function button.
3. Adjust the Hot Start level.
4. Repeat step 2, upon which the display will show the next adjustable parameter, depending on the switch mode.

Exit by pressing any button (except SETUP)

3.3.9. Use of gas test



If you press the gas test button, gas will begin to flow without any starting power source or wire feed. Gas flow can be measured by using an external measuring device.

Cut off the gas flow by pressing the same button again, or the gun trigger. If the trigger is not pressed again, the gas flow will end within 20 seconds.


The display will show "GAS" and the time.

3.3.10. Testing wire feed





The wire feed switch will start the wire feed motor without opening the gas valve. The power source will start up, but without providing welding power. The wire feed range will be 5m/min but can be adjusted as desired.

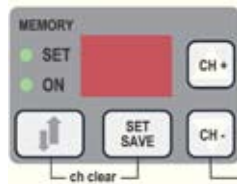3.3.11. Memory channels, MEMORY



The pulse panel has 100 channels for different welding options. Memory channels can be chosen on the lower part of the panel using the memory block. Both welding values and functions can be saved. Do the following:


1. Press  twice if needed and the SET light will start blinking if the channel is not in use, while the light will stay on if the channel is in use.
2. Select the memory channel you want by pressing CH button
3. Make settings and save by pressing SAVE button.
4. Press  twice. ON light turns on.
5. Start welding and set the values.

To change the values, the light must be switched from the ON to SET and then you can choose the parameters, pressing the SAVE button afterwards. It is also possible to save the used parameters by pressing SET when memory function is OFF (no lights). The channel can be emptied by pressing



and SET button in SET simultaneously.

Using saved settings

1. Press  button.
2. Select the memory channel by pressing the CH button.
3. Start welding.

Memory channels in control device

Select memory channels by pressing the CH REMOTE button simultaneously and the gun control light will start to blink. Use the saved values through the gun's remote control.

You can use five channels.

3.3.12. SETUP

Using the SETUP function, the user can change welding parameters which do not have their own panel functions. These parameters can be set separately for 1-MIG and Pulse MIG. SETUP settings are separate for each memory channel.

Setup functions on pulse panel

Parameter Name	Nr	Display	1-MIG	Pulsed MIG	Factory value	Unit	Explanation
PostGasTime	1	PoG	X	X	Curve	s	PostGas time 0.0...9.9 s
PreGasTime	2	PrG	X	X	Curve	s	PreGas time, functions by 2T 0.0...9.9 s
HotStartLevel	11	Hot	X	X	30	%	Hot start ratio to welding power 50...+75%
HotStartTime 2T	12	H2t	X	X	2	s	2T Hot start timer 0.1-9.9 s
CraterFillLevel	14	CFL	X	X	30	%	Welding end level 10-90 %
CraterFillSlope	15	CFS	X	X	1	s/10m	Wire slowing-down 1...20 s/10m
CreepStartLevel	17	CSL	X	X	Syn		Wire speed start value 10...90
CreepStartSlope	18	CSS	X	X	0	s/10m	Wire speed up time 0.1...5 s/10m
DoubleFrequency	21	dFr		X	Curve	Hz	Double pulse frequency control 0.4...8.0 Hz
DoubleAmplitude	22	dA		X	Curve	m/min	Double pulse power variation control 0.1...3.0 m/min
StartPower	31	StP	X	X	0		Start power control -9...0...+9
PulseCurrent	33	PuC		X	0	%	Pulse top current control 10...+15%
ArcLength AdjRange	41	ALr	X	X	0	%	Arc length adjustment range 50...+75%
Calibration	42	CAL	X	X	1	V/100A	Setting mid value of arc length fine adjustment 0.0...10.0 V/100A
WFS	51	FS			18	m/min	Wire feed maximum 18 or 25 m/min
Gun	53	Gun			On		liquidcooled thermal protection on/off
GunRemote	54	GrE			On		Disabling of gun remote control automatic identification
Display reset time	81	dLY	X	X	5	s	1...20 s
PRG INFO - feeld selection	82	diS	X	X	1		1,2,3
Restore	99	FAC	X		OFF		Restoring factory settings (OFF=no reset, Pan=panel and setup ALL= also memory channels)

Changing parameters

By pressing the 2T/4T (SETUP) selection switch a little longer the machine will enter the SETUP state. The display will show the set parameter's running number (blinking), its abbreviation and value. Select the parameter number using the "SYNERGIC PRG" + and - buttons or the "SETUP" button (which will jump by tens). Change the value using the control button (in some cases, the value can be found from the synergy curve). "Syn" and the curve value will blink by turns on the right of the display. Set the value by turning the button anticlockwise.

Exit for SETUP using a long press.

Frequency and amplitude of double pulse can be set in the separate 'SET' mode, obtained by first pressing the 2T/4T (SETUP) and, without releasing it, the method button. "dFr" and the frequency in Hz will be displayed. "Syn" will appear if the frequency is based on synergy curves. Change this value by turning the control button anticlockwise. Press it twice to display "dA" i.e. the amplitude (m/min). Adjust this accordingly and exit SETUP by pressing any button other than SETUP.

3.3.13. Error codes

Error codes are among others the following:

Err 3: Overvoltages in the mains supply. Also the pilot light of overvoltage is lighting.

Err 4: The thermal protection of power source has stopped welding. Also the pilot light of thermal protection is lighting.

Err 5: The cooling device has stopped welding.

Err 6: The terminal voltage has risen. Take the device to service.

Err 153: Liquid cooled PMT- or WS-gun is overheated. Or torch-PTC or RMT10 has been installed, but the jumper inside the torch is in FU-position, look also instruction of torch.

Err 154: Overloading of the wire feed motor

Error code is eliminated when the reason is aborted, except Err 6, which demands to turn down the machine.

3.4. COOLING UNIT OPERATION (KEMPACTCOOL 10)



The operation of cooling units KempactCool 10 is controlled by the power source. The cooling unit pump starts automatically when welding starts. Proceed as follows:

1. Start power source.
2. Check water level and input flow of the reservoir, add liquid if needed.
3. If you use a water-cooled gun you can fill it with cooling liquid by pressing TEST-button (on cooling unit).

The pump operates for 5 another minutes after welding has been finished to cool the liquid to the same temperature as in the machine surrounds. This reduces the need of service.

Thermal overload

The thermal overload light is lit, the machine stops and display shows Err 5 when temperature control of the machine has detected cooling water overheating. The cooling unit fan cools down the water, and when the light goes out welding can be started again.

Water flow signal

Display shows Err 5 when water flow is blocked.

4. MAINTENANCE

4.1. DAILY MAINTENANCE



Be careful of mains voltage when handling electric cables!

Clean the wire channel of the gun and check the contact tip regularly. Always check the condition of the mains and welding cable before operation and replace defective cables.



Note! Only a qualified electrician should remove or install the mains cable!

4.2. REGULAR MAINTENANCE

KEMPPI-service workshops sign special service contracts with customers for regular maintenance. All parts are cleaned, checked and if necessary, repaired. The operation of the welding machine is also tested.

4.3. DISPOSAL OF THE MACHINE



Do not dispose of electrical equipment together with normal waste!

In observance of European Directive 2002/96/EC on Waste Electrical and Electronic Equipment and its implementation in accordance with national law, electrical equipment that has reached the end of its life must be collected separately and returned to an environmentally compatible recycling facility. As the owner of the equipment, you should get information on approved collection systems from our local representative.

By applying this European Directive you will improve the environment and human health!

5. ORDERING INFORMATION

<i>Item</i>		<i>Ordering number</i>
Kempact Pulse 3000		621830002
KempactCool 10		621860001
GH 30 Gun holder		6256030
PMT 25	3 m	6252513
PMT 25	4,5 m	6252514
PMT 27	3 m	6252713
PMT 27	4,5 m	6252714
PMT 32	3 m	6253213
PMT 32	4,5 m	6253214
PMT 30W		6253043
PMT 30W		6253044
PMT 35	3 m	6253513
PMT 35	4,5 m	6253514
WS 35	6 m Al1,2	6253516A12
WS 35	6 m Ss1,0	6253516S10
WS 30W	6 m Al 1,2	6254206A12
WS 30W	6 m Ss 1,0	6254206S10

MMT 25	3 m	6252513MMT
MMT 25	4,5 m	6252514MMT
MMT 27	3 m	6252713MMT
MMT 27	4,5 m	6252714MMT
MMT 30W	3 m	6253043MMT
MMT 30W	4,5 m	6253044MMT
Remote Control Unit	RMT 10	6185475
Earth cable 35 mm ²	5 m	6184311
Transport unit ST 7		6185290 (for power source and gas bottle)
Transport unit P20		6185261 (power source, cooling unit and gas bottle)
Transport unit P250		6185268 (power source)
Lift hook		4298180
Gas hose	6 m	W000566
Wire spool pole		4289880
5 kg spool adapter		4251270

DuraTorque™ 400 metal feed rolls

Parts of the DT400 metal feed rolls					
W000731	gear ring 1	driving			2 pcs per unit
W000732	gear ring 2	pressing			2 pcs per unit
W000711	drive ring	V groove	1,2/1,2	optional	4 pcs per unit
W000718	drive ring	V groove	1,0/1,0	optional	4 pcs per unit
W000891	drive ring	V groove	1,0/1,2		4 pcs per unit
9420507	washer		10.5x30x2.5		2 pcs per unit

Recommended for aluminium welding with Pulse MIG.

6. TECHNICAL DATA

Kempact Pulse 3000		
Mains connection		3~400V +/-15%, 50/60Hz
Connected load		
	40% ED	12 kVA 250A
	60% ED	10 kVA 207A
	100% ED	7,5 kVA 160A
Mains cable/fuse		4x1,5 mm ² - 5 m/16A delayed
Load capacity		
	40% ED	250A /26,5V
	60% ED	207A /24V
	100% ED	160A /22V
Adjustment range		8 - 30V
Wire feed speed		1 - 18 m/min
Open circuit voltage		56 V
Power ratio		0,69 (250A / 26V)
Efficiency		0,84 (250A / 26V)
Filler wires		
	Fe, Ss	0,6 ... 1,2 mm
	Cored wire	0,9 ... 1,2 mm
	Al	0,9 ... 1,2 mm
	CuSi	0,8 ... 1,2 mm
Shielding gas		CO ₂ , Ar, Ar & CO ₂ mixed gases
Wire spool diameter		300 mm (15 kg)
Feed roll Ø		32 mm
Thermal class		H (180 °C) / B (130 °C)
Dimensions		
	length	580 mm
	width	280 mm
	height	440 mm
Weight		22 kg
Gun connector		EURO
Principle of operation		4-wheel feed
Cooling unit KempactCool 10		
Connection voltage		400 V - 15 % ... 10 %
Connection capacity		250 W
Cooling power		1 kW
Start pressure, max		4,5 bar
Cooling liquid		20 % - 40 % etanol/water
Reservoir volume		n. 3 l
External dimensions		
	length	580 mm
	width	280 mm
	height	300 mm
Weight		13 kg
Kempact Pulse 3000 and Cooling unit KempactCool 10		
Range of temperature for use		- 20 °C ...+ 40 °C
Storage temperature for use		- 40 °C ...+ 60 °C
Degree of protection		IP23C

The products meet conformance requirements for CE marking.

7. TERMS OF GUARANTEE

Kemppi Oy provides a guarantee for products manufactured and sold by them if defects in manufacture and materials occur. Guarantee repairs must be carried out only by an Authorised Kemppi Service Agent. Packing, freight and insurance costs to be paid by orderer. The guarantee is effected on the date of purchase. Verbal promises which do not comply with the terms of guarantee are not binding on guarantor.

Limitations on guarantee

The following conditions are not covered under the terms of guarantee: defects due to natural wear and tear, non-compliance with operating and maintenance instructions, connection to incorrect or faulty supply voltage (including voltage surges outside equipment spec.), incorrect gas pressure, overloading, transport or storage damage, fire or damage due to natural causes i.e. lightning or flooding.

This guarantee does not cover direct or indirect travelling costs, daily allowances or accommodation. Note: Under the terms of guarantee, welding torches and their consumables, feeder drive rolls and feeder guide tubes are not covered. Direct or indirect damage due to a defective product is not covered under the guarantee. The guarantee is void if changes are made to the product without approval of the manufacturer, or if repairs are carried out using non-approved spare parts.

The guarantee is also void if repairs are carried out by non-authorised agents.

Undertaking guarantee repairs

Guarantee defects must be informed to Kemppi or authorised Kemppi Service Agents within the guarantee period. Before any guarantee work is undertaken, the customer must provide proof of guarantee or proof of purchase, and serial number of the equipment in order to validate the guarantee. The parts replaced under the terms of guarantee remain the property of Kemppi.

Following the guarantee repair, the guarantee of the machine or equipment, repaired or replaced, will be continued to the end of the original guarantee period.

KEMPPPI OY
PL 13
FIN-15801 LAHTI
FINLAND
Tel +358 3 899 11
Telefax +358 3 899 428
www.kemppi.com

KEMPPIKONEET OY
PL 13
FIN-15801 LAHTI
FINLAND
Tel +358 3 899 11
Telefax +358 3 734 8398
e-mail: myynti.fi@kemppi.com

KEMPPPI SVERIGE AB
Box 717
S-194 27 UPPLANDS VÄSBY
SVERIGE
Tel +46 8 590 783 00
Telefax +46 8 590 823 94
e-mail: sales.se@kemppi.com

KEMPPPI NORGE A/S
Postboks 2151, Postterminalen
N-3103 TØNSBERG
NORGE
Tel +47 33 346000
Telefax +47 33 346010
e-mail: sales.no@kemppi.com

KEMPPPI DANMARK A/S
Literbuen 11
DK-2740 SKOVLUNDE
DANMARK
Tel +45 4494 1677
Telefax +45 4494 1536
e-mail:sales.dk@kemppi.com

KEMPPPI BENELUX B.V.
Postbus 5603
NL-4801 EA BREDA
NEDERLAND
Tel +31 765717750
Telefax +31 765716345
e-mail: sales.nl@kemppi.com

KEMPPPI (UK) Ltd
Martti Kemppi Building
Fraser Road
Priory Business Park
BEDFORD, MK443WH
ENGLAND
Tel +44 (0)845 6444201
Fax +44 (0)845 6444202
e-mail: sales.uk@kemppi.com

KEMPPPI FRANCE S.A.S.
65 Avenue de la Couronne des Prés
78681 EPONE CEDEX
FRANCE
Tel +33 1 30 90 04 40
Telefax +33 1 30 90 04 45
e-mail: sales.fr@kemppi.com

KEMPPPI GmbH
Otto-Hahn-Straße 14
D-35510 BUTZBACH
DEUTSCHLAND
Tel +49 6033 88 020
Telefax +49 6033 72 528
e-mail: sales.de@kemppi.com

KEMPPPI SPOLKA z.o.o.
Ul. Piłsudskiego 2
05-091 ŻĄBKI
POLAND
Tel +48 22 7816162
Telefax +48 22 7816505
e-mail: info.pl@kemppi.com

KEMPPPI AUSTRALIA PTY LTD.
25A, Stennett Road
INGLEBURN NSW 2565
AUSTRALIA
Tel. +61 2 9605 9500
Telefax +61 2 9605 5999
e-mail: info.au@kemppi.com

Kemppi OY LIMITADA
Av. Pdte. Edo. Frei Montalva 6001-81
Conchalí, SANTIAGO,
CHILE
Tel +56-2-949 1990
Telefax +56-2-949 1991
e-mail: arturo.silva@kemppi.com

ООО КЕМППИ
Polkovaya str. 1, Building 6
127018 MOSCOW
RUSSIA
Tel +7 495 739 4304
Telefax +7 495 739 4305
e-mail: info.ru@kemppi.com

ООО КЕМППИ
ул. Полковная 1, строение 6
127018 Москва
Tel +7 495 739 4304
Telefax +7 495 739 4305
e-mail: info.ru@kemppi.com